

## Adaptor M12 on top A-cod./MSUD valve plug CI-9.4mm

3-pol.

Form CI (9.4 mm) - M12, connector top entry 24 V AC  $\pm 20\%$  / DC  $\pm 25\%$ LED and suppression 3-pole


Plastic housings with good resistance against chemicals and oils.


The resistance to aggressive media should be individually tested for your application. Further details on request.


## **Link to Product**

## Illustration



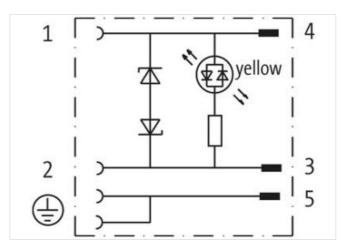

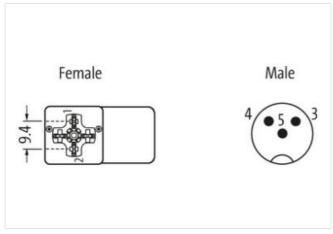

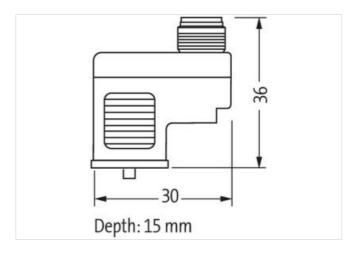

Product may differ from Image



Side 1	
Tightening torque	0,4 Nm
Family construction form	MSUD
Side 2	
Tightening torque	0,6 Nm

The information in this Product-PDF has been compiled with the utmost care.

Liability for the correctness completeness and topicality of the information is restricted to gross negligence. Version: 2024-05-14



Family construction form	M12	
Commercial data		
ECLASS-6.0	27143423	
ECLASS-6.1	27279221	
ECLASS-7.0	27440104	
ECLASS-8.0	27440104	
ECLASS-9.0	27440106	
ECLASS-10.1	27440106	
ECLASS-11.1	27440106	
ECLASS-12.0	27440106	
ETIM-5.0	EC001855	
customs tariff number	85366990	
GTIN	4048879348720	
Packaging unit	1	
Electrical data   Supply		
Operating voltage AC	24 V	
Operating voltage AC min.	19,2 V	
Operating voltage AC max.	28,8 V	
Operating voltage DC	24 V	
Operating voltage DC min.	18 V	
Operating voltage DC max.	30 V	
Cut-off peak voltage max.	55 V	
Current operating per contact max.	4 A	
Current consumption max.	15 mA	
Installation   Connection		
Mounting set	M3	
Installation   Pin assignment		
No. of poles	2 + PE	
Device protection   Electrical		
Degree of protection (EN IEC 60529)	IP67	
Additional condition protection degree	inserted, screwed	
Environmental characteristics   Climatic		
Operating temperature min.	-25 °C	
Operating temperature max.	85 °C	
Important installation notes		
Note on strain relief	Protect the connectors by suitable measures from mechanical loads, e.g. by the usage of cable ties.	
Note on bending radius	<b>Attention:</b> Observe the permissible bending radii when laying cables, as the IP protection class can be endangered by excessive bending forces.	